

SHARP**CATEGORY: Bc**

Technical Report

SUBJECT: ON TIMER FAULT

REF: SP010500X

PAGE: 1 / 1

DATE: 14 MARCH 2001

IRISH Symptom Code: ----

IRIS Section: ----

GENERAL

Have been detected that in some TV the ON TIMER fails at tensions over 220V. The reason of this fault is that the supply μ P slave is not stable over 220V AC.

MODELS

&

SERIAL. N°

MODEL NAME	SERIAL No.	MODEL NAME	SERIAL No.	MODEL NAME	SERIAL No.
60FW53E	800219	72GF63E	800124	76FW53H	715755
70FW53E	800313	81GF66E	800908	76FW54H	715374
70FW53ESE	803865	70GF66E	800331	76GF64H	712396
70FW57E	712330	70GF63E	711580	66GF63H	716170
81FW53E	801244	81GF63E	800213	66GF64H	711605
81FW53ESE	802420	56FW53H	734992	66FW54H	716235
81FW57E	714524	66FW53H	742399	72GF66E	80057

INTERCHAN-GEABILITY


A: ↔ INTERCHANGEABLE	B: → From OLD to NEW	C: ← From NEW to OLD	D: NO X INTERCHANGEABLE
-------------------------	-------------------------	-------------------------	----------------------------

PARTS

REF No.	NEW PARTS DESCRIPTION	OLD PARTS NUMBER	NEW PARTS NUMBER	INTERCH-ANGEABI-LITY	EFFEC-TI VE FROM	CO-DE
R703	RES. 150K 1/2W	VRD-RA2HD4 74J	VRD-RA2HD154J	B	-	AA
R721	RES. 150K 1/2W	VRD-RA2HD4 74J	VRD-RA2HD154J	B	-	AA

SERVICING

R721
R703

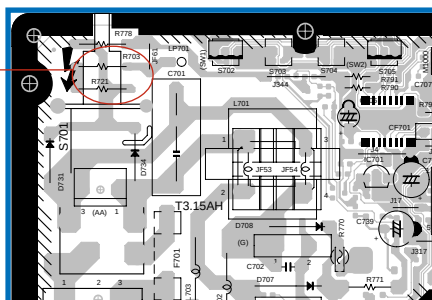

QPWBF7240BMN*
QPWBF7293BMN*